

SWITCH OF MEASURING POINTS

- MANUAL SWITCH OF MEASURING POINTS 4x 10
- SIZE OF DIN 96 x 48 MM

OPERATION

Switching of the measuring points is performed by a revolving switch on the front panel.


OMA 10S

The OMA 10S is a manual panel switch of measuring points.

For its parameters, low transitional resistance and high endurance the switch is designed for low-voltage applications (e.g. for sensors Pt 100).

OMA 10S

MANUAL SWITCH OF MEASURING POINTS

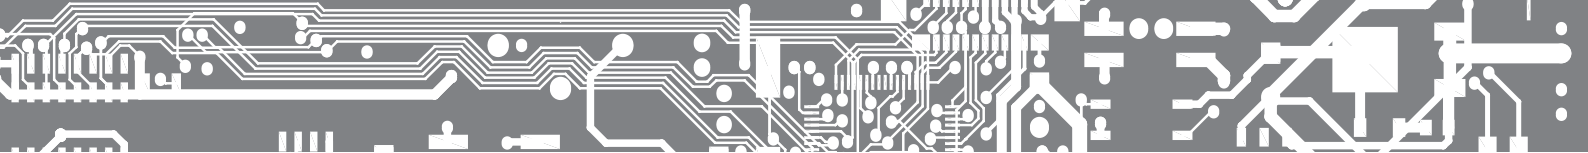

TECHNICAL DATA

INPUT

Connection: 4x 10 positions

- number of positions is adjustable inside the switch [2...10x 4]

Max. load: 30 VDC/100 mA

Max. switched current: 5 mA

MECHANIC PROPERTIES

Material: Noryl GFN2 SE1, incombustible UL 94 V-1

Dimensions: 96 x 48 x 120 mm (w x h x d)

Panel cutout: 90,5 x 46 mm (w x h)

OPERATING CONDITIONS

Connection: connector terminal blocks, section < 1,5 mm²

Working temperature: -20°...60°C

Storage temperature: -20°...85°C


Protection: IP40

Insulation resistance: 50 V

El. safety: EN 61010-1, A2

PI - Primary insulation, DI - Double insulation

CONNECTION

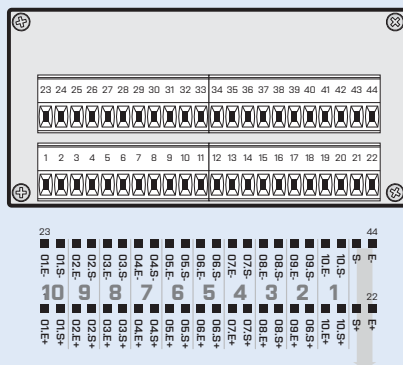

ORDER CODE

OMA 10S